

TECHNICAL DATASHEET



iSCAN 211



Handheld Bluetooth barcode scanner for Zone 1 and 21 hazardous areas

Use alongside a base station, smartphone, or tablet with wireless Bluetooth link

Variants to read all standard 1D, 2D, and stacked PDF barcodes

ATEX and IECEx Zone 1 and 21 certified

RS232/RS422 or USB interface options

IP65 fully rugged

Lightweight and easy to handle with ergonomic grip

Visual, audio, and vibration feedback for user

High speed scanning, up to 500 scans per second

Wider scan line and long reading distance for easy use

Works effectively in bright sunlight, up to 100,000 lux

Variety of accessories available

www.extronics.com | info@extronics.com | +44 (0) 845 277 5000

414875(5)

Disclaimer: Copyright (c) Extronics Ltd. The information contained in this document is subject to change without notice. Extronics cannot be held responsible for any errors or inaccuracies within this document.

Extronics Released

| | |
|---------------------------|---|
| 1D barcode types | Code 39, Code 39 Trioptic, Code 32, Code 93, Code 11, Codabar, Code 128, GS1-128 / EAN 128, UPC / EAN / JAN (with addition), MSI/Plessey, UK/Plessey, IATA, Interleaved 2 of 5, Standard and Industrial 2 of 5, Matrix 2 of 5, Telepen, GS1 DataBar, Australian Post, China Post, German Post, US Planet, US Postnet, British Post, Intelligent Mail, Japan Post, Korean Post, Dutch KIX Post |
| Stacked PDF barcode types | PDF417, MicroPDF417, Code 49, Code 16K, Composite, Codablock F |
| 2D barcode types | Data Matrix, QR Code, MicroQR-Code, Aztec, MaxiCode |

SYSTEM ASSEMBLY

Hazardous area charging:

This assembly requires a base station (iSCAN211EXB3), a power supply (iSCANPSx), a connection cable between the two (iSCAN2XXCAB5, 6, 9, or 10), and connections between the power supply and a PC (not supplied by Extronics).

External connection cable requirements:

Data cable


USB: 0.2 – 2.5 mm², 4-wire

RS232: 0.2 – 2.5 mm², 3-wire

Power supply cable

0.2 – 2.5 mm², 3-wire

For technical information on the iSCANPS, please refer to the product manual

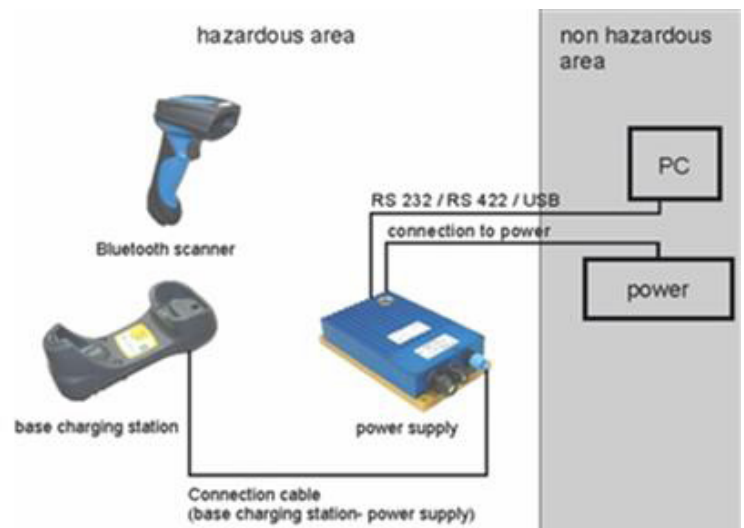


Safe area charging:

This assembly requires a non-Ex base or charging station (iSCAN211B3 or iSCAN211BNOBT3).

If connecting the base or charging station to a PC via USB, the USB cable (iSCAN2XXCAB3 or 4) can provide both data and power connections in one cable.

If connecting the base or charging station to a PC via RS232 (iSCAN2XXCAB1 or 2), this can only support data. The base or charging station will require an additional power connection (iSCAN2XXBLP).

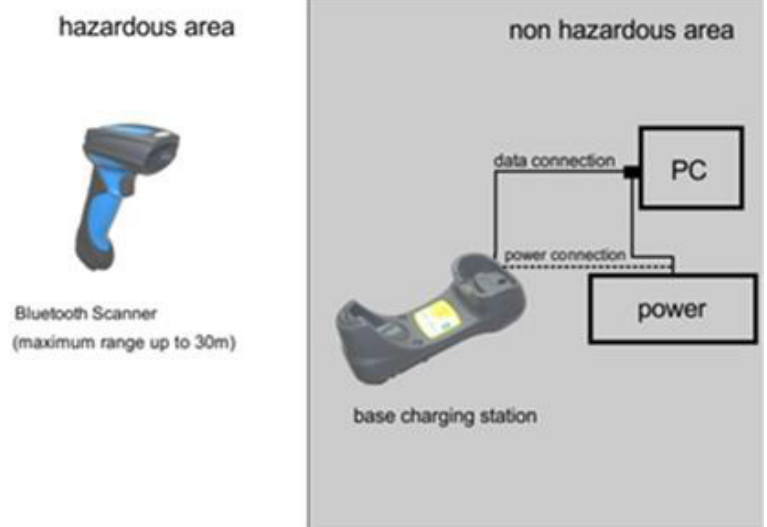

SPECIFICATION



| | |
|-------------------------------|--|
| Certification | iSCAN211, iSCAN211PDF: II 2G Ex ib IIB T4 Gb, II 2D Ex ib IIIC T135°C Db iSCAN2112D: II 2G Ex ib op is IIB T4 Gb, II 2D Ex ib op is IIIC T135°C Db |
| Dimensions | H185 x L104 x W76 mm |
| Weight | 260g (handset including battery) |
| Ingress protection | IP65 |
| Ambient operating temperature | -20°C to +50°C |
| Humidity | ± 95 %, non condensing |
| Ambient light resistance | 100,000 lux |
| Bluetooth | V4.0, 2.402 ... 2.4830 GHz Wireless operating range up to 100 m (line of sight), batch function to expand wireless radius, up to seven scanners communicate with one base station |
| Scanning frequency | iSCAN211 and iSCAN211PDF: 500 Hz iSCAN2112D: 60 Hz |
| Light source | Visible red light 630 nm |
| Reading distance | iSCAN211 and iSCAN211PDF: 20 to 850 mm iSCAN2112D: 30 to 400 mm |
| User feedback signals | 2 LEDs (operation status and read feedback) Audio beeper Vibration |
| Base station interface | RS232/RS422 or USB |
| Battery | Lithium ion battery, 3.6V, ≤ 1500mAh |
| Operating voltage | 4.9V, supplied via iSCANPSx |
| Required accessories | <p>+ compatible base or charging station (<i>if connecting the Bluetooth scanner to an alternative Bluetooth device e.g. tablet, a base station may not be required. However, a charging station is still necessary. A base station also acts as a charging station</i>)</p> <p>+ compatible cable to connect base station to power supply (iSCAN2XXCABX)</p> <p>+ compatible power supply (iSCANPSx if using the base station in the hazardous area; iSCAN2xxBLP if using a base/charging station in the safe area)</p> <p><i>For details of options, please see Ordering Information</i></p> |



ORDERING INFORMATION



Handsets

ISCAN211

iSCAN211 handheld Bluetooth scanner, handset and battery only, reads 1D barcodes, Zone 1/21 certified

ISCAN211PDF

iSCAN211 handheld Bluetooth scanner, handset and battery only, reads 1D and stacked PDF barcodes, Zone 1/21 certified

ISCAN2112D

iSCAN211 handheld Bluetooth scanner, handset and battery only, reads 1D, stacked PDF, and 2D barcodes, Zone 1/21 certified

HAZARDOUS AREA CHARGING:

Base station

ISCAN211EXB3

Base station for all iSCAN211 versions, without cable, Zone 1/21 certified

Cable to connect base station to power supply

ISCAN2XXCAB5

Base station connection cable, RS232, 1.8 m, Zone 1/21

ISCAN2XXCAB6

Base station connection cable, RS232, spiral, 3.8 m, Zone 1/21

ISCAN2XXCAB9

Base station connection cable, USB 1.8 m, Zone 1/21

ISCAN2XXCAB10

Base station connection cable, USB, spiral, 3.8 m, Zone 1/21

Power supply

ISCANPS1

Power supply module, DC 24V, RS232, Zone 1/21

ISCANPS2

Power supply module, DC 24V, USB, Zone 1/21

ISCANPS3

Power supply module, AC 230V, RS232, Zone 1/21

ISCANPS4

Power supply module, AC 230V, USB, Zone 1/21

SAFE AREA CHARGING:

Base or charging station

ISCAN211B3

Base station for all iSCAN211 versions, without cable, non-Ex

ISCAN211BN0BT3

Charging station for all iSCAN211 versions, without Bluetooth, without cable, non-Ex

Cable to connect base or charging station and PC

ISCAN2XXCAB1

Base station connection cable, RS232, 1.8 m

ISCAN2XXCAB2

Base station connection cable, RS232, spiral, 3.8 m

ISCAN2XXCAB3

Base station connection cable, USB 1.8 m

ISCAN2XXCAB4

Base station connection cable, USB, spiral, 3.8 m

ORDERING INFORMATION



Power supply for base or charging station (if RS232)

ISCAN2XXBLP

Power supply for base or charging station, DC 5V, non-Ex

OPTIONAL ACCESSORIES:

Battery

ISCAN2X3BATT

Spare lithium ion battery for iSCAN211, Zone 1/21

Stands

ISCANSTRI

Tripod stand for all iSCAN1xx and iSCAN2xx variants

ISCANSTAB

Tabletop stand for all iSCAN1xx and iSCAN2xx variants

Extension cables (RS232 only)

ISCANCC1

Extension cable with male connector, 6 m, Zone 1

ISCANCC2

Extension cable with male connector, spiral, 4.5 m, Zone 1

Please note that these extension cables may only be used with iSCAN2XXCAB1, 2, 5, or 6 options (RS232).